



17. 六の平櫓内部北西面全影



18. 六の平櫓内部小屋見上げ（西面）



19. 本丸東御門正面（東面）



20. 本丸東御門背面（西面）



21. 腕木御門正面（北面）



22. 腕木御門背面（南面）




23. 三の平櫓東復元土塙全影




24. 厥曲輪東隅復元土塙全影



25. 本丸東面復元土塙全影

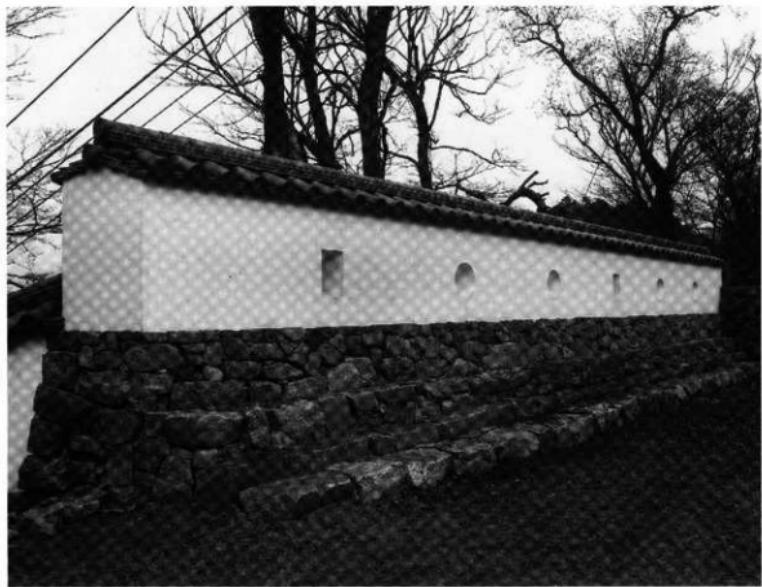

26. 本丸西面復元土塙全影

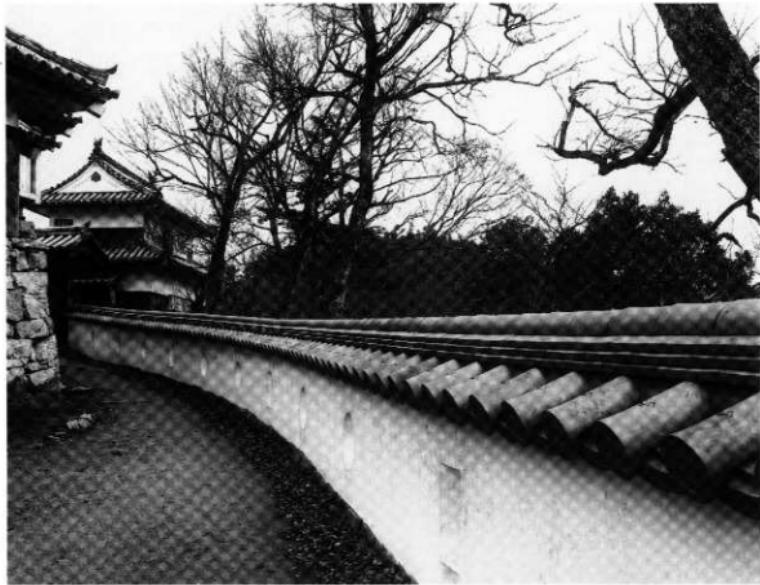

27. 天守東側復元土塙全影



28. 二重橋前西面復元土塙全影




29. 現場事務所倉庫及  
索道荷上げ拠点



30. 本丸内索道鉄骨橋組立



31. 本丸東土塁用足場組状態

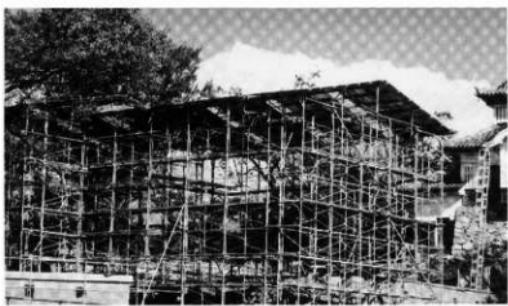


32. 五の平櫓・六の平櫓の  
素屋根建設



33. 五の平檜・六の平檜用  
松丸太材



34. 五の平檜・六の平檜の  
柱材加工 (新はつり)

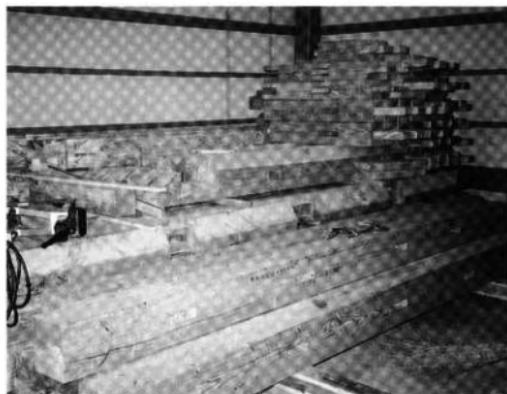

35. 五の平檜・六の平檜の  
部材加工済状態


36. 六の平櫓基礎石修正  
(欠失部分は補足する。)



37. 六の平櫓束石据え  
壺堀り、コンクリート打ち、  
根巻きモルタル据えとする。



38. 五の平櫓土台取付  
下端石垣天にひかり付け高  
低差を修正する。

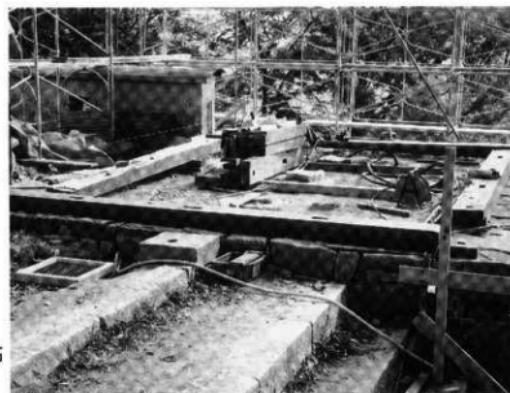



39. 六の平櫛軸部組立状態



40. 五の平櫛東妻小屋架構状態



41. 五の平櫛出入口個所軸部  
架構、肘木は庇出桁を受ける。

42. 六の平櫓、北西隅木取付



43. 五の平櫓、妻軒廻り取付



44. 五の平櫓化粧垂木取付





45. 五の平檜西妻垂木取付状態



46. 五の平檜東妻破風板  
取付状態



47. 六の平檜野地板張り



48. 五の平檜西妻土居葺施工  
檻手割板で葺上げる。



49. 六の平檜土居葺完成全影  
檻の手割材で葺足 6 cm で  
葺上げる。



50. 五の平檜平瓦受用継棟打ち  
横棟は平瓦銅線留用棟



51. 六の平檜平瓦葺施工状態  
平瓦葺には筋置土を用いる。



52. 六の平檜丸瓦葺施工状態



53. 六の平檜隅鬼瓦取付状態  
(鬼瓦は発掘されたものを復元する。)




54. 六の平檜東妻瓦葺施工状態



55. 六の平檜本丸瓦完了状態  
棟、軒先は、避雷針銅帯取付施工状態



56. 六の平檜鰐瓦取付完了状態

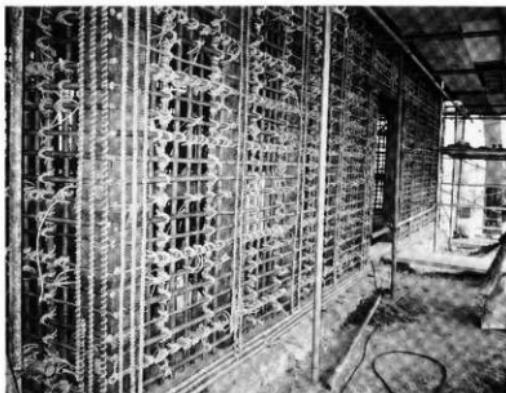

57. 六の平樋大壁小舞搔き状態  
(縦横小舞とも丸竹を用いる。)



58. 五の平樋荒壁付け施工  
(15cm大に丸めて小舞に押し  
込めて塗上げる。)



59. 六の平樋大壁裏返し施工状態



60. 出入口庇塗込め小舞繩巻き  
付け施工状態(六の平樁北面)




61. 出窓塗込用繩巻き状態




62. 軒廻り塗込用繩巻き付け施  
工状態




63. 出入口庇塗込砂漆噴塗施工  
状態(五の平樁)

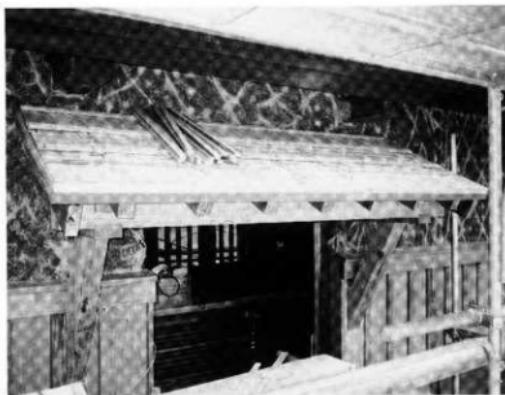


64. 六の平櫓出入口庇取付

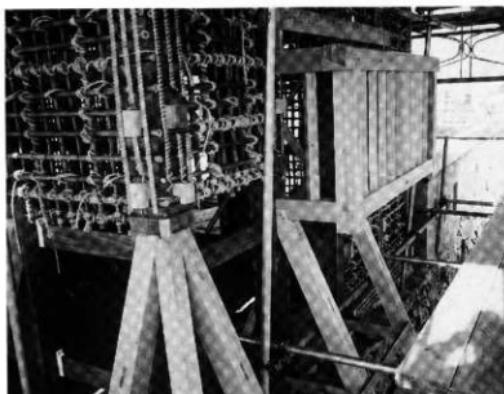

65. 五の平櫓東面出窓、石落し  
個所取付

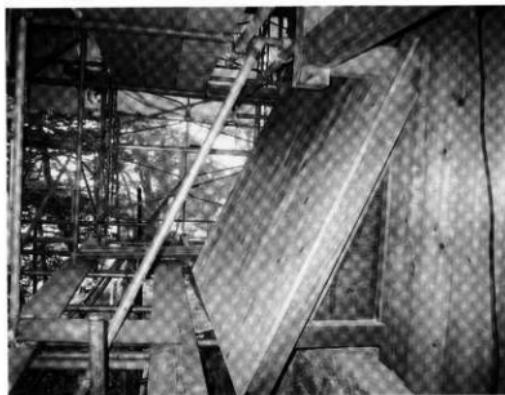


66. 六の平櫓南西隅石落し外壁

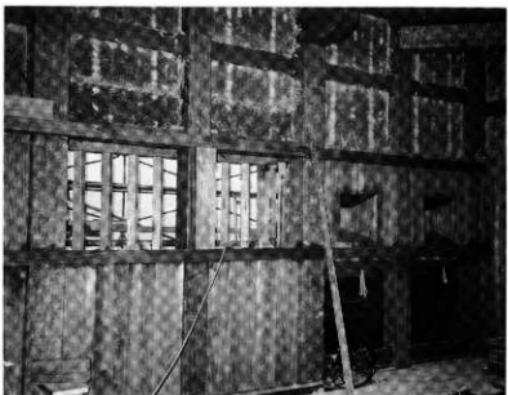

67. 六の平樁南面出窓、鉄眼木  
造り



68. 六の平樁南面西寄り銳眼石  
落し個所

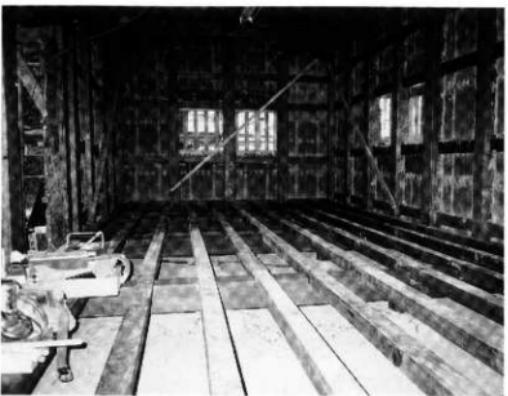

69. 六の平樁根太取付状態



70. 本丸南御門軒廻り取付



71. 同上平軒廻り状態



72. 同上化粧裏板張り状態



73. 同上完成状態（正面）



74. 土塀仮枠組立状態



75. 土塀内部の丸竹補強入状態



76. 土塀鍛眼型棒取付状態



77. 本丸東面土塀板枠取はずし状態



78. 土塀屋根葺、斑直し  
施工状態



79. 土塀屋根葺施工状態  
(本丸東面五の平櫓に取付く)



80. 土塀屋根瓦葺施工状態  
(天守東面で腕木門に続く)



81. 東御門土居葺施工




82. 東御門屋根瓦葺施工



83. 東御門屋根葺完成状態



84. 東御門全影

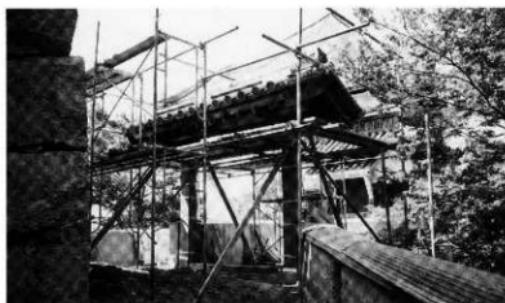

85. 脱木御門組立状態



86. 同上化粧軒裏見上状態



87. 同上完成状態



88. 本丸登り口石垣の積直し施工  
(石垣を測量後解体する。)



89. 同上石垣裏込め施工状態  
(裏込には、1 m巾に砂利を入れる)



90. 同上石垣積直し完了状態



91. 本丸東面石垣の不陸状態  
(樹木の切株が石垣を崩す。)



92. 同上石垣補修完了状態



93. 本瓦西面土堀前石段復旧状態  
(土堀下端中央部分に埃り落し口がある。)



94. 路地門完成状態



95. 本丸東面排水施工工事状態



96. 木部防腐処理作業



# 史跡 備中松山城跡本丸復元整備記録

1. 建造物名称	五の平櫓、六の平櫓、本丸南御門、東御門、(裏)腕木門、路地門、土塀	
2. 分類	史跡	
3. 指定年月日	昭和31年11月7日	
4. 所在地	岡山県高梁市内山下	
5. 所有者	高梁市	
6. 建物種別	城郭櫓門	
7. 建築年代		
8. 材料及び構造	木造	
9. 屋根形式及び 屋根葺材	五の平櫓 入母屋造、本瓦葺 六の平櫓 入母屋造、本瓦葺 本丸南御門 切妻造、本瓦葺 東御門 切妻造、本瓦葺 (裏)腕木門 切妻造、本瓦葺	
10. 尺法	正面m	側面m
	五の平櫓	5.908
	六の平櫓	9.847
	本丸南御門	2.727
	東御門	2.757
	(裏)腕木門	2.757
	路地門	0.83
	土塀	延198
11. 事業内容		
修理種別	復元整備工事	
工期	平成7年1月17日～平成9年3月31日 (27か月)	
経費	365,000,000円	
12. 工事報告書		
書名	史跡備中松山城跡復元整備工事報告書	
発行年月	平成9年3月31日	
著者、編集者	森 宏之 (高梁市教育委員会) 五味盛重、藤島輝・(財団法人 文化財建造物保存技術協会)	
発行者(出版社)	高梁市教育委員会	
13. 修理歴	該当なし	
14. 備考	史跡備中松山城跡等整備委員会を組織し、平成3年度に国庫補助事業として史跡保存管理計画を策定。平成4年には史跡整備の基本計画を進め、平成6年度に「史跡備中松山城跡本丸南御門周辺復元整備(現状変更)にかかる資料」が審議され、文化庁文化財保存審議会の了承を得て平成7年1月より工事の運びとなった。	

## DOCUMENTATION ON THE RESTORATION WORK AT BITCHU MATSUYAMA CASTLE SITE,a Historic site

1. Name of property	Fifth tower,Sixth tower,Front "South" gate,East gate,Rear "udegi" gate, Street gate and Earthen wall		
2. Classification	Historic Site		
3. Date of designation	7 Nov. 1956		
4. Location	Uchisange,Takahashi,Okayama Prefecture		
5. Owner	Takahashi City		
6. Building type	castle tower gate		
7. Year of construction			
8. Material and structure	wood frame		
9. Roof style and roofing material	Fifth tower	hipped and gabled	roofing material tiles(concave and convex)
	Sixth tower		tiles(concave and convex)
	Front gate	hipped and gabled	tiles(concave and convex)
	East gate	gabled	tiles(concave and convex)
	Rear "udegi" gate	gabled	tiles(concave and convex)
	Street gate	gabled	tiles(concave and convex)
	Earthen wall		tiles(concave and convex)
10. Dimensions	width [ m ]		
	Fifth gate	5.908	depth [ m ]
	Sixth gate	9.847	
	Front gate	2.727	
	East gate	2.757	
	Rear "udegi" gate	2.757	
	Street gate	0.830	
	Earthen wall	total 198.000	
11. Summary of work			
Type of repair	reconstruction and repair		
Construction period	Jan. 1995 - Mar. 1997 ( 27months )		
Cost	365,000,000yen		
12. Restoration report			
Title	Report on the Reconstruction and Repair Work at Bitchu Matsuyama Castle		
Date of issue	Site31 Mar. 1997		
Author and editor	MORI Hiroyuki,Takahashi City the Board of Education GOMI Morishige, FUJISHIMA Toruichi/JACAM		
Publisher	Takahashi City the Board of Education		
13. Previous restoration work	not applicable		
14. Notes	A repair Committee was founded for the restoration of the Bitchu Matsuyama Castle Site. In 1991, a preservation and management plan was established as a nationally funded project, and in 1992, the basic plans were executed. In 1994, permission for "alteration of the present state" and reconstruction on the premises of the Bitchu Matsuyama Castle Site was obtained from the Council for the Protection of Cultural Properties of the Agency for the Cultural Affairs. Construction was begun in January of 1995.		

平成9年3月

**史跡備中松山城跡本丸復元整備工事報告書**

著作・編集 岡山県高梁市教育委員会  
財団法人 文化財建造物保存技術協会

発 行 岡山県高梁市教育委員会  
〒716 岡山県高梁市松原通2117-1

印刷・製本 岡山県農協印刷株式会社  
〒700 岡山市富町2丁目5-27

